



Magnetic drilling machine

ECO.100**S+/CT2**

With cross slide table

Congratulations on purchasing this premium magnetic drilling machine. At EUROBOOR we strive to exceed our customers' expectations by developing and providing premium and innovative portable drilling and cutting solutions. We believe that a professional like you must be able to rely on a professional supplier. Which has led us to become a major player in the industrial world, with our own factory and several offices worldwide. All because we have always listened to our customers and to the demands from the market.

Our vision is focused on developing innovative portable tools that add value for our customers and facilitate them in their daily work. We never lose sight of sustainability, time savings and cost savings.

Enjoy your new machine!

Before operating your new magnetic drilling machine, please first read all instructions. You find the instructions in this manual and on the warning label on your machine. With proper use, care and maintenance your machine will provide you with years of premium drilling performance.

TO REDUCE THE RISK OF INJURY USER MUST READ AND UNDERSTAND ALL INSTRUCTIONS

To view all our offices and their contact information please visit: www.euroboor.com

The original manual has been produced in the English language. If any discrepancies should occur in translations, reference must be made to the original version for clarification.

1. Table of contents

1.	Table of contents	3
2.	Safety	4
2.1.	General safety instructions	4
2.2.	Specific safety information	6
3.	Description	8
3.1.	Intended use	8
3.2.	Description and features	8
3.3.	Case content	9
3.4.	Serial number	9
3.5.	Technical data	10
3.6.	Symbols	11
3.7.	Environmental	12
4.	Preparation & adjustment	13
4.1.	Assembly	13
4.2.	Prior to use	14
5.	Using the machine	16
5.1.	Control panel	16
5.2.	Morse taper spindle	16
5.3.	Electromagnet	17
5.4.	Cross slide table	19
5.5.	Four-speed manual gearbox	20
5.6.	Switching motor on and off	20
5.7.	Motor rotation	20
5.8.	Motor speed control	21
5.9.	Torque control	21
5.10.	Power protection	21
5.11.	Power fluctuation protection	21
5.12.	Power surge protection	21
5.13.	Overheat protection	22
5.14.	Carbon brushes	22
5.15.	Tool lubrication	22
6.	Working with drilling accessories	24
6.1.	Annular cutters	24
6.2.	Twist drills	25
6.3.	Machine taps	27
6.4.	Countersinks	28
6.5.	Milling	28
7.	Maintenance	30
8.	Troubleshooting	32
9.	Exploded views & spare parts list	34
9.1.	Exploded views	34
9.2.	Spare part lists	37
9.3.	Wiring diagram	39
9.4.	Warranty and service	40

2. Safety

2.1. General safety instructions

Do not use this magnetic drilling machine before you have thoroughly read and completely understood this manual, specifically the “General safety instructions” and “Specific safety information”, including the figures, specifications, safety regulations and the signs indicating DANGER, WARNING and CAUTION.



WARNING: *When using electrical tools basic safety precautions should always be followed to reduce the risk of fire, electrical shock and personal injury.*

Please also observe the relevant national industrial safety regulations. Non-observance of the safety instructions can lead to an electric shock, burns and/or severe injuries.

This manual should be kept for later use and enclosed with the magnetic drilling machine, should it be passed on or sold.

Work area

1. Keep your work area clean and well lit. Cluttered and dark work areas increase the change of accidents;
2. Do not operate a magnetic drilling machine in explosive atmospheres, such as in the presence of flammable liquids, gases or dust. A magnetic drilling machine may create sparks which could ignite the dust or fumes;
3. Keep bystanders, children and visitors away while operating a magnetic drilling machine. Distractions can cause you to lose control.

Electrical safety

1. A magnetic drilling machine plug must match the outlet. Never modify the plug in any way. Do not use any adapter plugs;
2. Avoid body contact with grounded surfaces such as pipes, radiators, ranges and refrigerators. There is an increased risk of electric shock if your body is grounded;
3. Do not expose the magnetic drilling machine to rain or wet conditions. Water entering a machine will increase the risk of electric shock;
4. Do not abuse the cord. Never use the cord to carry the magnetic drilling machine or pull the plug from an outlet. Keep the cord away from heat, oil, sharp edges or moving parts. Replace damaged cords immediately. Damaged cords increase the risk of electric shock;
5. When operating a magnetic drilling machine, use an extension cord suitable for outdoor use, this reduces the risk of electric shock;
6. If operating a magnetic drilling machine in a damp location is unavoidable, use a residual current device (RCD), this reduces the risk of electric shock.

Personal safety

1. Stay alert, watch what you are doing and use common sense when using a magnetic drilling machine. Do not use the machine while tired or under the influence of drugs, alcohol, or medication. A moment of inattention while operating a magnetic drilling machine may result in serious personal injury;
2. Dress properly. Do not wear loose clothing or jewelry. Keep your hair, clothing and gloves away from moving parts. Loose clothes, jewelry, or long hair can be caught in moving parts;
3. Avoid accidental starting. Be sure the switch is off before plugging the machine in. Carrying a magnetic drilling machine with your finger on the switch or plugging in a magnetic drilling machine that has the switch on increases the change of accidents;
4. Never place hands, fingers, gloves or clothing near drilling area or rotating machine parts;
5. Remove adjusting keys or switches before turning the machine on. A wrench or a key that is left attached to a rotating part of the machine may result in personal injury;
6. Do not overreach. Keep proper footing and balance at all times. Proper footing and balance enables better control of the magnetic drilling machine in unexpected situations;
7. Use safety equipment. Always wear eye protection. Dust mask, non-skid safety shoes, hard hat and hearing protection must be used for optimal safety;
8. Always use supplied safety chain during any work on non-horizontal surfaces. Magnetic drilling machine can release from surface.



WARNING: *Wear ear and eye protection when using this machine.*

Machine use and care

1. When using the machine on non-horizontal surfaces, you must use cutting paste. Do not use oil because the oil can drip into the motor unit;
2. While operating the machine, the annular cutter must be cooled and lubricated with high quality cutting lubricants;
3. Always remove the slug from the annular cutter after each hole.



WARNING: *The metal slug can be sharp and very hot!*

4. Use clamps or other practical solutions to secure and support the workpiece to a stable platform. Do not use the machine when the switch does not turn it on or off. Any machine that cannot be controlled with the switch is dangerous and must be repaired;
5. Disconnect the plug from the power source before making any adjustments, changing accessories or storing the tool. Such preventive safety measures reduce the risk of starting the tool accidentally;
6. Store your magnetic drilling machine out of reach for children and other untrained persons. Tools are dangerous in the hands of untrained users;
7. Maintain your machine with care. Keep cutting tools sharp and clean. Properly maintained tools, with sharp cutting edges are less likely to break and are easier to control;
8. Check for misalignment of moving parts, breakage of parts and any other condition that may affect the machine's operation. If you detect damage have the machine serviced before use. Many accidents are caused by poorly maintained tools;
9. Only use accessories that are recommended by EUROBOOR for your machine model. Accessories that are suitable for one machine may become hazardous when used on another machine.

Service

1. Tool service must be performed only by qualified repair personnel. Service or maintenance performed by unqualified personnel could result in risk of injury;
2. When servicing a tool, use only identical replacement parts. Follow instructions in the maintenance section of this manual. Use of unauthorized parts or failure to follow maintenance instructions may create a risk of electric shock or injury;
3. EUROBOOR offers Armature kits containing official EUROBOOR spare parts suitable for your magnetic drilling machine.

2.2. Specific safety information

- Keep your fingers away from the drilling area;
- Avoid touching the slug that is automatically ejected by the pilot pin when the working procedure is finished. Contact with the slug when it is hot, or if it falls, can cause personal injuries;
- Always use the safety guard. Before switching on the machine ensure that the guard is closed securely;
- Always use the safety chain;
- The magnetic drilling machine is suitable for use on steel with a thickness starting from 6 mm, with zero air gap between the magnet core surface and the mounting surface. Curvature, coats of paint and surface irregularities will create an air gap. Keep the air gap to a minimum;
- Always place the machine on a flat surface;
- Do not clamp the magnetic drilling machine on small or irregular shaped objects;
- Always place the machine on a surface that is clear of shavings, chips, swarf and surface dirt;
- Keep the magnet clean and free of debris and swarf;
- Do not switch on the machine before checking whether the magnetic stand has been tightened firmly to the mounting surface;
- Adjust the machine so cutter does not extend into the workpiece before drilling. Do not perform any design, assembly or construction activities on the workpiece while the machine is switched on;
- Before switching on the machine, make sure all accessories have been mounted correctly;
- Do not switch on the machine until it has been mounted and installed according to all above mentioned instructions;
- Always use the recommended speed for the accessories and material you are working with;
- Do not use the machine on the same workpiece on which electric welders are working;
- Only use an appropriate cutting lubricant. EUROBOOR offers a wide range of well-considered cooling and lubrication products to match your requirements;
- Do not use liquid cutting fluids while drilling vertically or overhead. Dip the cutter in cutting paste or apply an appropriate spray for these applications;
- Do not pour cutting fluid into the reservoir while it is mounted in the bracket. Do not allow cutting fluid to enter the drill motor;
- Before use, ensure movable safety guard operates properly;
- In case of a jammed cutter, turn off the machine, disconnect the machine from the power supply and then remove the reason for the jam before turning on the machine again.

Residual risk

In spite of following the relevant safety regulations and their implementation, certain residual risks cannot be avoided. These are:

- Impairment of hearing;
- Risk of personal injury from flying particles;
- Risk of burns due to accessories becoming hot during operation;
- Risk of personal injury due to prolonged use.


Always try to reduce these risks as much as possible.

3. Description

3.1. Intended use

This magnetic drilling machine is intended for commercial use as a drilling machine for drilling materials with a magnetizable surface using annular cutters and twist drills, and for countersinking light milling in a weather-protected environment using the application tools and accessories recommended by EUROBOOR. The magnetic drilling machine can only be used horizontally or vertically.

3.2. Description and features

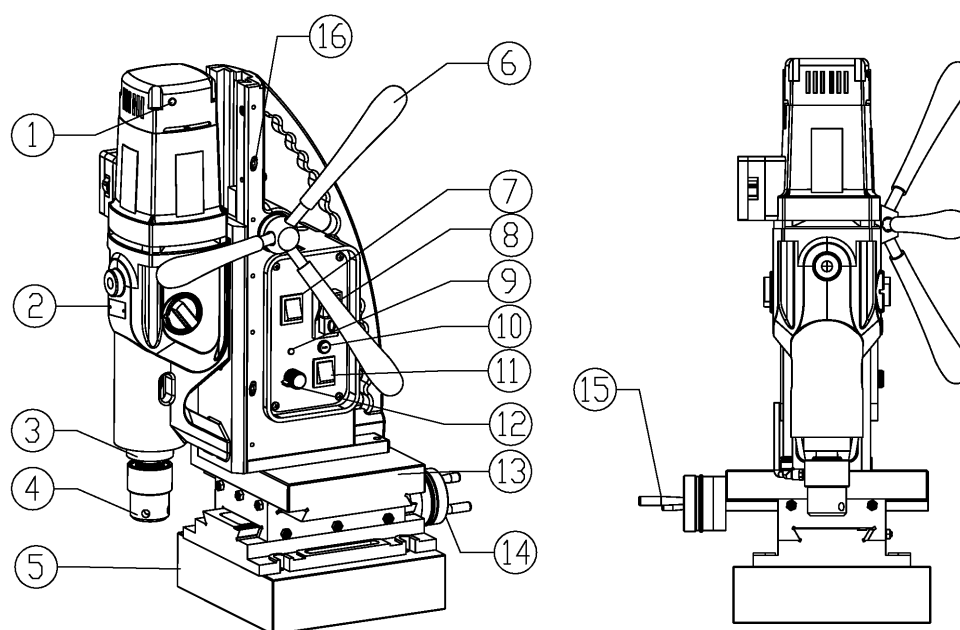

[image 2-1]

1. Carbon brush LED indicator
2. Gearbox guide
3. Output shaft
4. Morse taper spindle
5. Electromagnet
6. Feed handle
7. L/R switch
8. Motor switch

9. Magnet LED indicator
10. Fuse holder
11. Magnet switch
12. Speed control knob
13. Cross slide table
14. Y-Axis handwheel
15. X-Axis handwheel
16. Stop screw

3.3. Case content

- 1 x ECO.100S+/CT Magnetic drilling machine
- 3 x handles
- 1 x side handle M12
- 1 x hex key 2.5 mm
- 1 x hex key 3 mm
- 1 x hex key 4 mm
- 1 x hex key 5 mm
- 1 x hex key 8 mm
- 1 x lubrication system
- 1 x safety chain
- 1 x arbor MT3 to Weldon 31.75 mm (1 1/4") incl. lubrication ring
- 1 x adapter Weldon 31.75 to 19.05 mm (1 1/4" to 3/4")
- 1xMT3 milling chuck(optional)
- 1 x extension spindle MT3
- 1 x Morse taper ejector drift key
- 1 x user manual
- 1 x safety ear protection
- 1 x safety goggles
- 1 x safety gloves

3.4. Serial number

The serial number is mentioned on the machine three times: engraved on the frame, engraved on the magnet and on the serial no. sticker on the motor housing. Additional serial no. stickers are provided with the machine for your administration.

The serial number will help you, your dealer and EUROBOOR to validate and identify the machine.

For example:

1002003001

breaks down to:

100 20 03 001

Machine series

Year of manufacture


Month of manufacture

Identification number



3.5. Technical data

		Metric	Imperial
Annular cutting		Ø 12 - 100 mm	Ø 1/2" - 13 15/16"
Twist drilling		Ø 1 - 31.75 mm	Ø 1/16" - 1 1/4"
Tapping		M3 - M30	1/8" - 1 3/16"
Countersinking		Ø 10 - 105 mm	Ø 3/8" - 4 1/8"
Length		497 mm	19 9/16"
Width		375 mm	14 9/64"
Height		528 - 790 mm	24 23/32" - 35"
Stroke		260 mm	10 1/4"
Travel distance	X-axis	50mm+65mm	2"+2 9/16"
	Y-axis	120mm	4 23/32"
Weight		55 kg	121lbs
Magnet (l x w x h)		220 x 220 x 64 mm	8 11/16" x 8 11/16" x 2 1/2"
Magnetic force		4,400 kg	9700lbs
Motor power		1,900 W	15.5 A
Total power		2,200 W	17.5 A
Speed (no load)		(I) 42 - 110rpm	
		(II) 65 - 190rpm	
		(III) 140 - 400rpm	
		(IV) 220 - 620rpm	
Speed (1,900 W load)		(I) 85 rpm	
		(II) 152rpm	
		(III) 270rpm	
		(IV) 480rpm	
Spindle		MT3 to Weldon 31.75 mm	MT3 to Weldon 1 1/4"
Voltage		220 - 240 V / 50 - 60 Hz	110 - 120 V / 60 Hz



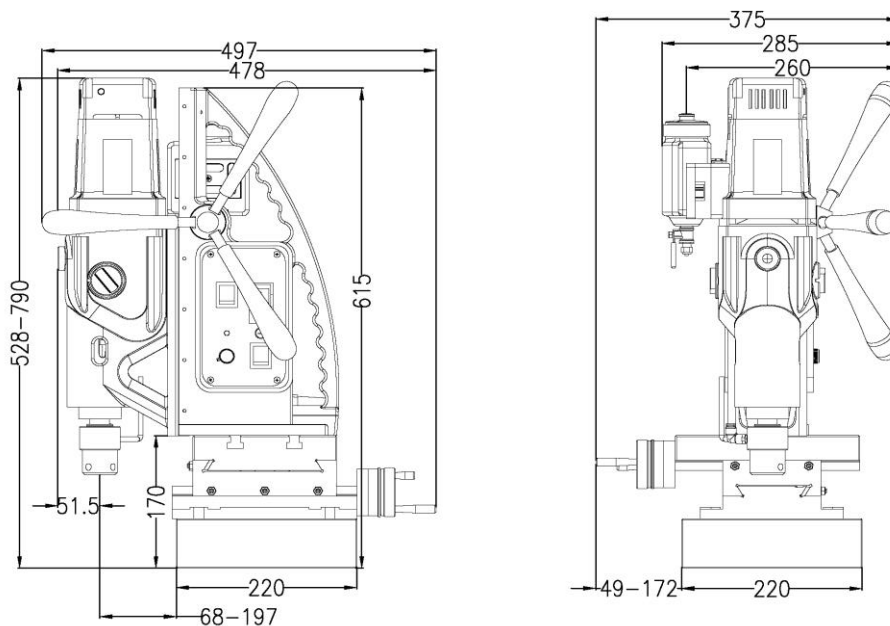



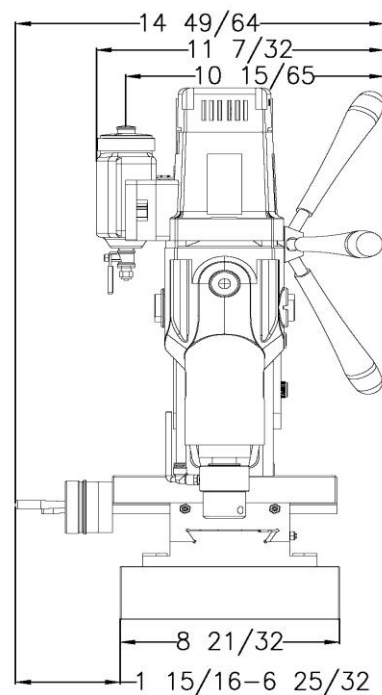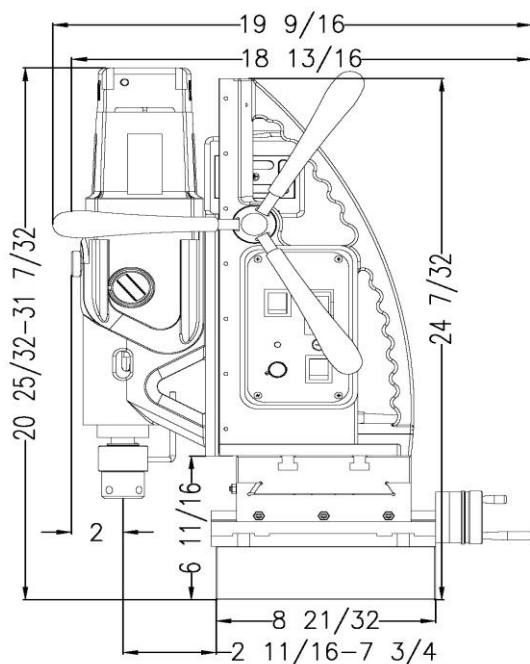

Dimensions(mm)





Dimensions(inches)



3.6. Symbols

Symbol	Term, meaning	Explanation
	Read documentation	Be sure to read the documentation in this user manual and specifically the “General safety instructions” and “Specific safety information”
	Wear ear protection	Use ear protection during operation
	Wear eye protection	Use eye protection during operation
	Danger/warning/caution	Read and apply the information in the adjacent text!
	European conformity	Conformity with EEA machine regulations
	Class of protection I	Product with basic insulation and exposed (touchable) conductive parts additionally connected to the protective earth conductor
	Electromagnetic Compatibility	Able to function acceptably in its electromagnetic environment
	International Electrotechnical Commission	Conformity with international electrotechnical safety standards

Symbol	Term, meaning	Explanation
	ISO9001	Certified in accordance with ISO9001:2015 quality management system
	UL	Certified by Underwriters Laboratories (UL), a recognized laboratory for safety testing approved by US federal agency OSHA
mm	Millimeter	Unit of measure for the dimensions
"	Inch	Unit of measure for the dimensions
kg	Kilogram	Unit of measure for the mass
lbs	Pound	Unit of measure for the mass
V	Volt	Unit of measure for the electric voltage
A	Ampere	Unit of measure for the electric current intensity
W	Watt	Unit of measure for the output
rpm	Revolutions per minute	Unit of measure for the revolutions

3.7. Environmental



Separate collection. This product must not be disposed of with normal household waste.



Separate collection of used products and packaging allows materials to be recycled and used again. Re-use of recycled materials helps prevent environmental pollution and reduces the demand for raw materials.


Local regulations may provide for separate collection of electrical products from the household, at municipal waste sites or at the retailer when you purchase a new product.

4. Preparation & adjustment

4.1. Assembly



WARNING: To reduce the risk of injury, turn machine off and disconnect from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure all switches are in the OFF position. An accidental start-up can cause injury.

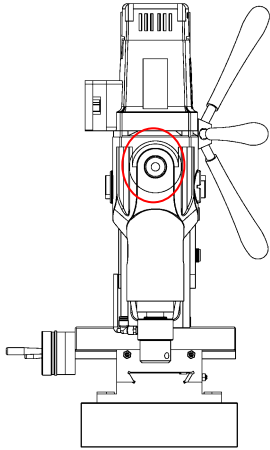


[image 3-1 | Side handle position]

Fitting the feed handles

1. Fit each of the three feed handles by screwing them into the hub in clockwise direction;
 2. Tighten firmly by hand.
- The handles are supposed to face slightly outward. Be careful not to cross-thread any of the components.

Fitting the side handle (optional)

To simplify the repositioning of the machine on the workpiece, with the spring ball function at the backend of the magnet or otherwise, fit the side handle to the machine by screwing it into the appropriate side hole of the motor unit.

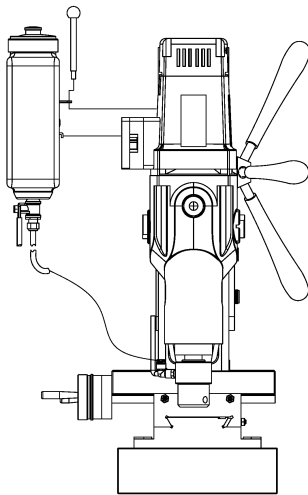

[image 3-2]

Fitting the lubrication system

The lubrication system can only be used for horizontal drilling

1. Hang the tank on the tank holder;
2. Position and tighten the attachment pin;
3. Connect the hose to the fitting on the gearbox. Make sure the hose is connected fully and tightly;
4. To disconnect the hose, press the blue ring on the connection and gently pull out the hose.

In order to use the lubrication system, it must be filled with a sufficient amount of cutting fluid.

1. Make sure the flow regulator is closed;
2. Unscrew the cap;
3. Fill the container with cutting fluid;
4. 4. Screw the cap back on.



WARNING: Do not use the lubrication system in vertical drilling applications.

Fitting the safety chain

1. Pass the safety chain through the frame grip opening;
2. Wrap the chain around the workpiece;
3. Securely close the chain using the lock.



WARNING: *The safety chain does not replace the magnetic force of the magnetic drilling machine: it is simply used to protect the operator in the event of machine slipping*

4.2. Prior to use

Please make sure that the contacting surface for the magnet is level, clean and rust free. Remove any varnish or primer. When working on materials that are not magnetizable, suitable fixation devices, obtainable as accessories from EUROBOOR, e. g. suction plate, vacuum plate or pipe-drilling machine must be used.

When working on steel materials with a material thickness of less than 6 mm, the workpiece must be reinforced with an additional steel plate in order to guarantee the magnetic holding power.

Check the machine for possible damage; Before using the machine, you must carefully check the protective components or slightly damaged components to ensure they are operating perfectly and as intended.

Check that moving parts are in perfect working order, do not jam and check whether the parts are damaged. All parts must be correctly installed and fulfill all conditions necessary to ensure perfect operation of the machine.

Damaged protective components must be repaired or replaced according to specifications by EUROBOOR or any authorized EUROBOOR dealer.

DO NOT use under wet conditions or in presence of flammable liquids or gases.

DO NOT let children come into contact with the machine. Supervision is required when inexperienced operators use this machine.

Electrical safety

The electric motor has been designed for one voltage only. Always check that the power supply corresponds to the voltage on the rating plate.

Your EUROBOOR magnetic drilling machine is designed in class I (grounded) according to EN 61029-1. Earth wire is required.

If the supply cord is damaged, it must be replaced by a specially prepared cord available at EUROBOOR or your EUROBOOR dealer.

Extension cord

If an extension cord is required, use an approved 3-core cable suitable for the power input of this machine (see technical data):

- The minimum conductor size is 1.5 mm² (for 220V) or 14 AWG (Amperage Wire Gauge for 110V) for 7.5 m (± 25ft)
- The minimum conductor size is 2.5 mm² (for 220V) or 12 AWG (Amperage Wire Gauge for 110V) for 15 m (± 50ft).
- The minimum conductor size is 2.5 - 4 mm² (for 220V) or 10 AWG (Amperage Wire Gauge for 110V) for 30 m (± 100ft).



WARNING: *When using a reel, always unwind the cable completely!*

Useful tips

- Try a few simple projects using scrap material until you develop a “feel” for the magnetic drilling machine;
- Let the machine run in for a period of eight to ten hours before starting with big operations. Do not load the machine too much during this run-in period;
- Never use the machine with serious overload;
- Keep the machine clear from moisture at all times to protect the machine, yourself and others.

5. Using the machine



WARNING: Always observe the safety instructions and applicable regulations.




WARNING: To reduce the risk of serious personal injury, turn the machine off and disconnect the machine from power source before making any adjustments or removing/installing attachments or accessories.

5.1. Control panel

The control panel on your magnetic drilling machine is designed for maximum ease of use and safety.


1. Magnet switch
2. Speed control knob
3. Fuse holder
4. Magnet LED indicator
5. Motor switch
6. L/R switch

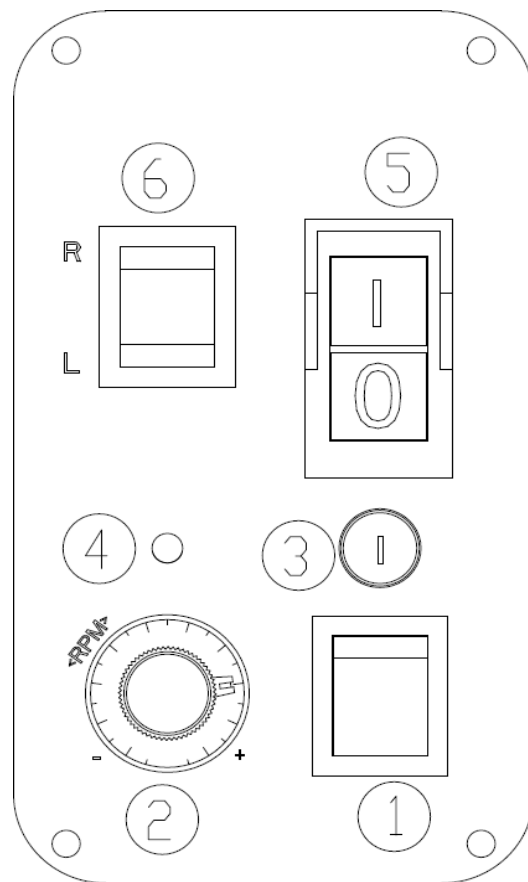

[image 4-1]

5.2. Morse taper spindle

1. Make sure the inside of the output shaft and the Morse taper spindle are clean and free of grease;
2. Position the lubrication ring rotation limiter behind the bridge between the output shaft and the frame;
3. Firmly slide the Morse taper spindle into the output shaft by hand (A). Make sure the spindle is properly positioned. You should not be able to pull it out by hand and tighten the nut;

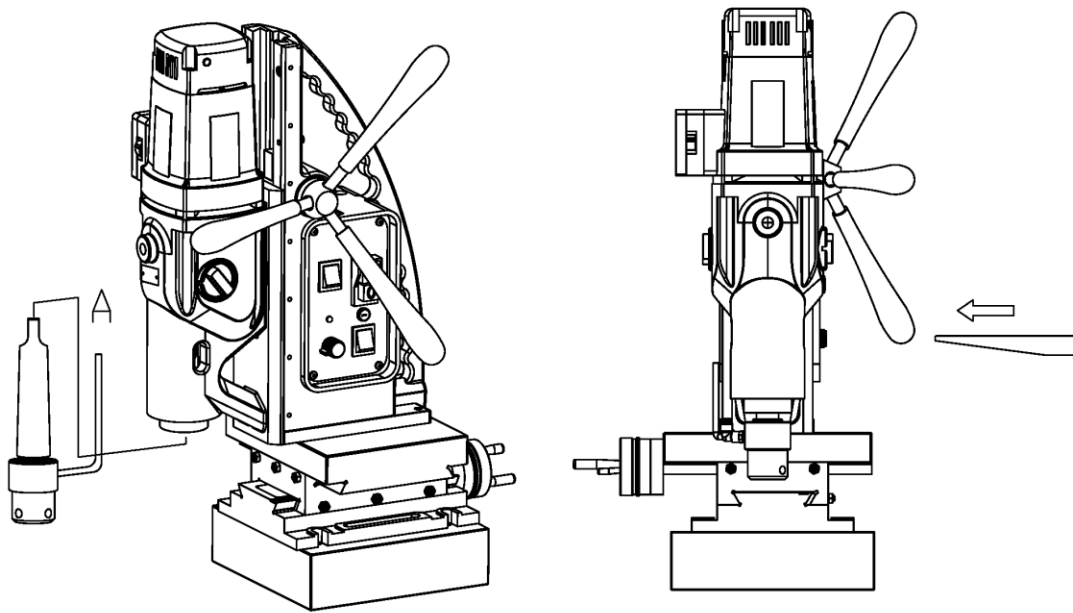

[image4-3][image4-4]


4. To remove the Morse taper spindle:

- Switch off the motor;
- Rotate the mechanical gear switch to neutral (see paragraph 4.3Gearbox);
- Rotate the output shaft until the slots on the shaft align with the slots on the gearbox;
- Loosen the nut and gently tap the supplied drift into the slots to push the Morse taper arbor out.

5.3. Electromagnet

Make sure the magnetic drilling machine is placed on a smooth, clean, level and solid surface without any objects or debris to guarantee maximum adhesion.

The workpiece must at least be 6 mm (1/4") thick for the magnet to stick and to drill safely. In case the workpiece is between 3 mm (1/8") and 6 mm (1/4"), make sure to make a proper base to create a good magnetic field as shown below.

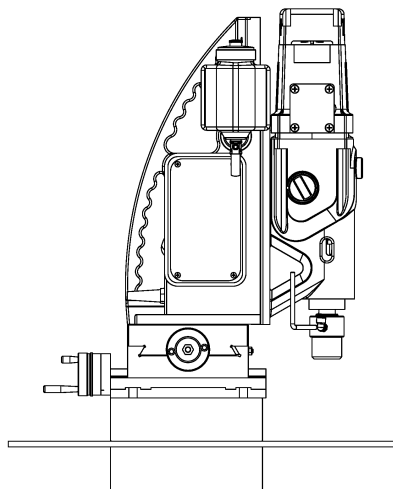

[image 4-2]

The electromagnet will work best on surfaces of at least 10 mm (3/8") thickness.

When the electromagnet is not able to create a good enough magnetic field, this may be caused by:

- Surface not being flat;
- Workpiece is not magnetizable (e.g. aluminum);
- Workpiece is coated or painted;

Workpiece is not thick enough.

In this situation the magnet indicator will light up red. Make sure to solve any of these matters before proceeding in any way and creating unsafe situations.

2-Way electromagnet

This machine is equipped with a 2-way magnet function. At half of the magnetic force (2,200 kg), the magnet sufficiently sticks to the surface to hold the machine in position while not in use. More importantly, it consumes less energy, generates less heat and as a consequence will last longer. Only with full magnetic force (4,400 kg) the machine can be used for drilling.

Using the 2-way magnet:

1. Place and position the machine on the workpiece;
2. To activate the magnet at half of the magnetic force, press the RED magnet switch. The magnet switch will be lit. The magnet LED indicator lights up GREEN when the generated magnetic force is sufficient to hold the machine in position while not drilling;
3. For full magnetic force, press the GREEN motor switch (see next paragraph);
4. To deactivate the magnet, first press the RED motor switch to return to half magnetic force and then press the RED magnet switch again.



WARNING: Do not use this machine when LED indicator is RED. Magnet may not generate sufficient attachment force.


We want to point out that above mentioned precautions and indicators do not guarantee that the magnet will not release from the material. EUROBOOR accepts no liability when it comes to the magnet indicator not functioning or functioning poorly.

Make sure that the magnet attaches tightly to the work piece before turning on the motor unit of the magnetic drilling machine. This electromagnet has four coils; make sure that both coils are in contact with the material. Do not connect any other machine to the same electrical outlet which the magnetic drilling machine is plugged into, as it may result in the loss of magnetic force.

5.4. Cross slide table

To facilitate the positioning of tool above the workpiece, this machine is equipped with a cross slide table. With the magnet properly attached to the workpiece, the cross slide table allows you to move the machine longitudinally and laterally.

With 115mm of X-axis travel and 120mm of Y-axis travel, the machine provides easy adjustability for the operator. The travel is controlled by X-and Y-axis table handwheel, by rotating the corresponding one, the tool can be moved into the desired position.

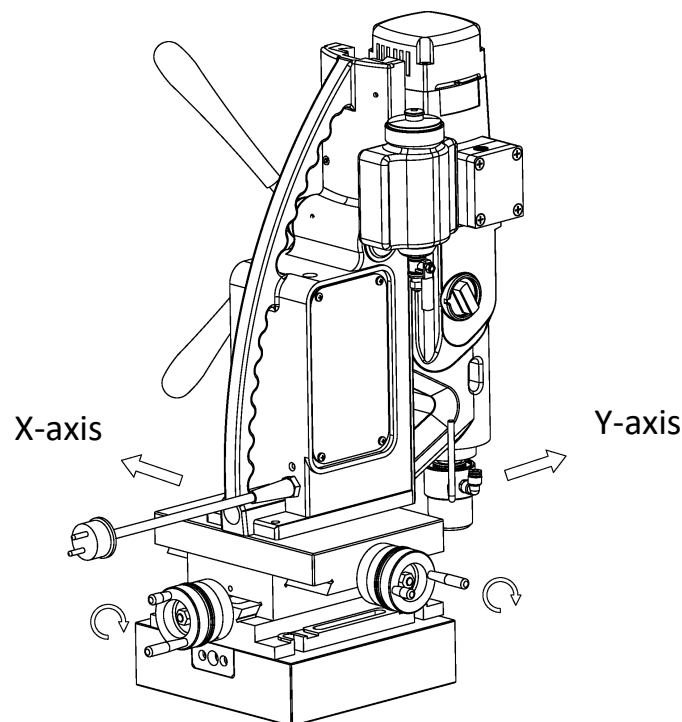

Always use the safety chain included. Drilling above your head is extremely dangerous and is not recommended. For the use of magnetic drilling machines on pipes, not-flat or non-magnetic materials, we refer to our catalogue or our website www.euroboor.com where several vacuum tightening systems, pipe clamping systems and Tube machines can be found.

5.5. Four-speed manual gearbox


This machine is equipped with a 4-speed gearbox. Gear switches on both sides make it possible to select 4 different speeds manually. Select the closest gear and speed for the intended operation.

1. To select the correct gear from neutral (horizontal) position:
 - a. Rotate the switch counter clockwise to position **o**;
 - b. Rotate the switch clockwise to position **oo**.
2. A gear is only correctly selected when the gearbox switches are both aligned with the indicators on the gearbox:

In case you have trouble fully and correctly selecting a gear, the gears in the gearbox might be misaligned. Slightly rotating the output shaft by hand will help you to align the gears and correctly and fully select the intended gear;

3. Speed selection for annular cutters (also see plate on gearbox):

Gear	Front switch	Back switch	Speed	Cutter Ø	Cutter Ø
I	OO	O	42 - 110 rpm	80 - 100 mm	3 1/8" - 3 15/16"
II	O	O	66 - 190 rpm	51 - 79 mm	2" - 3 1/8"
III	OO	OO	140 - 400 rpm	27 - 50 mm	1 1/16" - 2"
IV	O	OO	220 - 620 rpm	12 - 26 mm	1/2" - 1"

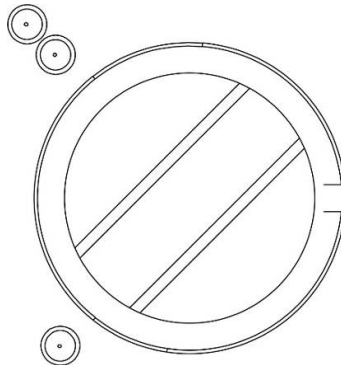

[image 4-5]

5.6. Switching motor on and off

The motor unit can only be switched ON when the magnet is activated. To switch the motor ON, press the green button with marking "I". To switch the motor OFF, press the red button with marking "O".

5.7. Motor rotation

The rotational direction of the motor can be changed:

Switch in up position (R) will make the motor rotate clockwise;

Switch in down position (L) will make the motor rotate counterclockwise;

Switch in middle position will not make the motor rotate (neutral position).

Before switching the rotational direction of the motor and spindle, make sure the motor is switched off first, to prevent machine and tool damage.

5.8. Motor speed control

The speed control knob (potentiometer) allows you to electronically control the speed of the motor (in both clockwise and counter clockwise direction):

The indicator of the potentiometer in bottom left corner is minimum speed;

The indicator of the potentiometer in bottom right corner is maximum speed;

The electronic motor speed control works for both mechanical gears. Be careful not to overturn the knob.

5.9. Torque control

Built-in electronic torque control will automatically stop the motor in case of overload. Adjust the torque by turning the red rotary knob at the backside of the motor unit into the “–” direction. Then push the red motor switch with “O” marking to reset the motor, and the green motor switch with “I” marking to start drilling again.

5.10. Power protection

The power protection feature is two-fold; it consists of both power fluctuation protection and power surge protection. Special safety components built into the electronics of the machine make it more reliable in situations where power supply can be of varying quality due to factors:

- Around the workplace, for example caused by switching on high power or unreliable electrical devices, a broken circuit breaker or faulty wiring;
- Outside the workplace, for example caused by an instable power grid or lightning.
-

A machine with this feature is able to cope with standard rated voltage and frequency fluctuations ranging from:

- 110 Volt to 130 Volt and 45 Hz to 65 Hz, or
- 220 Volt to 240 Volt and 45 Hz to 65Hz

reducing the probability of breakdown and minimizing down-time and repair cost.

5.11. Power fluctuation protection

When the frequency is too high (above 65 Hz) or too low (below 45 Hz), the motor will not start. If the frequency of the power supply falls outside the range during your drilling job, the motor will shut off automatically. The machine will work again normally when the normal frequency has been restored.*

5.12. Power surge protection

Beyond the rated voltage, a machine with this feature is able to cope with voltage spikes up to 4,000 Volt (1-2 μ s)*. Depending on the height of the spike, it may be necessary to replace built-in fuses, the control unit or the power switch, but other valuable parts like the motor and magnet will be protected.

Disclaimer: Euroboor is not liable for any damage caused to the machine due to electrical problems in the workplace. Above mentioned protection is not guaranteed in all cases of voltage spikes and/or frequency fluctuations. Euroboor accepts no liability when it comes to the power protection not functioning or functioning poorly.

In the situation of the motor being shut off automatically as self-protection, you should:

- Shut off the magnet;
- Disconnect the machine from the power source;
- Fix the source of the problem, by either:
 - o Making sure the issues with the power source is fixed;
 - o Connect the machine to a different and reliable power source;
- Continue using the machine as described in this user manual.

5.13. Overheat protection

This machine is supplied with an all-time electronic overheat protection. If the temperature of the motor unit runs up to 70° C (158 °F) the motor unit will stop. After a few minutes it can be started again. When it is possible to start the motor again, let the motor run idle at full speed for a couple of minutes to let the motor cool down more in an efficient way.

5.14. Carbon brushes

This machine is equipped with carbon brushes with two protection features. The purpose of both features is to schedule timely service and avoid additional costs by unexpected downtime or unnecessary part replacement.

Carbon brush wear indicator

On top of the motor housing you will find an integrated LED light. Under normal circumstances this light is off. The LED light will start burning red when the carbon brushes are worn to a level where it is advised to replace them.

Actual remaining operating time depends on the use of the machine, but can be up to 12 operating hours. This makes it possible to schedule service of the machine and avoid unexpected downtime.

Automatic shut-off

As additional protection, when the carbon brushes are actually worn to a level where replacement is needed, the motor will shut off automatically. This prevents the armature from being damaged. During automatic shut-off, the carbon brush wear indicator is not lit.

It is critical to replace both carbon brushes in the motor unit simultaneously. Otherwise the LED warning function may be affected, and damage the motor in the end. For replacement of carbon brushes, see chapter 6. Maintenance.

5.15. Tool lubrication

Horizontal applications

In order to use the lubrication system, the tank must be filled with a cutting lubricant.

1. Make sure the flow regulator is closed;
 2. Unscrew the cap;
 3. Fill the container with cutting lubricant;
 4. Screw the cap back on.
- Adjust the fluid flow as required using the flow regulator;
 - Add more cutting lubricant when the shavings (metal chips) become blue.



WARNING: *Do not use the lubrication system in vertical drilling applications.
Instead use EUROBOOR cutting paste or spray.*

Make sure to use only suitable cutting lubricants. EUROBOOR offers a wide range of cutting lubricants for all tool and material combinations. Proper lubrication will help you create better and faster results, and extend the lifetime of your tools.

6. Working with drilling accessories

6.1. Annular cutters

Annular cutters only cut material at the periphery of the hole, rather than converting the entire hole to shavings. As a result, the energy required to make a hole is lower than for a twist drill.

When drilling with an annular cutter, it is not necessary to drill a pilot hole.



WARNING: Do not touch the cutter or the parts close to the cutter immediately after operation, as they may be extremely hot and cause burns to the skin. Ensure nobody is in the work area where the metal core (slug) is ejected.

Drilling conditions

The ease with which material can be drilled depends on several factors including tensile strength and abrasion resistance. Whilst hardness and/or strength is the usual criterion, wide variations in machinability can exist among material showing similar physical properties.


The drilling conditions are dependent on requirements for tool life and surface finish. These conditions are further restricted by the rigidity of the tool and the workpiece, lubrication and machine power available. The harder the material, the lower the cutting speed.

Some materials of low hardness contain abrasive substances leading to rapid cutting edge wear at high speeds. Feed rates are governed by rigidity of set-up, volume of material to be removed, surface finish and available machine power.

Drilling a hole

Now that you have read the information and safety recommendations above, you are ready to actually start drilling. Follow these 13 steps for best drilling result:

1. Install the annular cutter:
 - Place the pilot pin into the cutter;
 - Align the flat faces on the cutter shank with the screws in the tool holder;
 - Make sure the cutter shank is entered fully and correctly;
 - Tighten the screws;

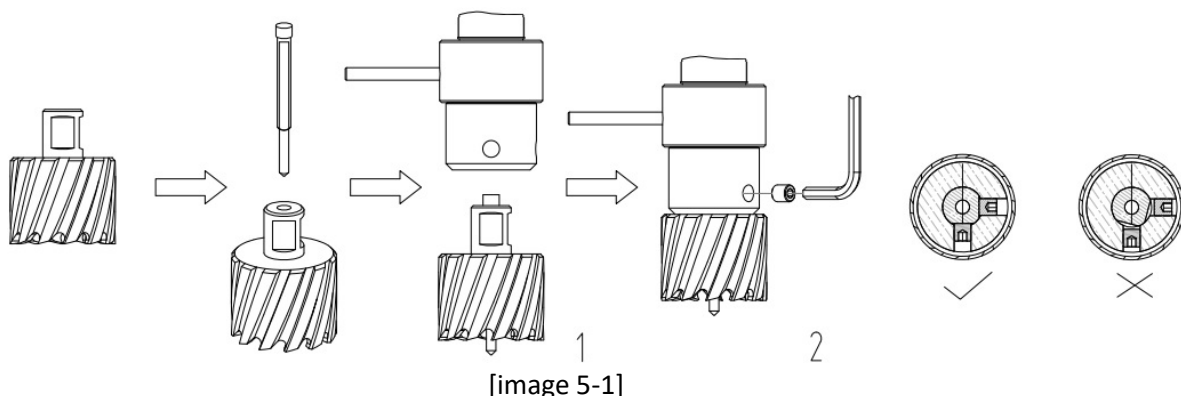

2. Loosen the stop screw before turning the feed handles.
3. Precisely mark the center of the hole;
4. Use the pilot pin to position the machine in the correct position, with the tip of the pilot pin to meet the marked center of the hole;

5. Switch on the magnet and verify that the drill is in the right position and that the machine is pushed tight against the work piece;
6. Fill the holes of the spindle with oil;
7. Switch the motor on and allow it to run at the required speed;
8. Turn the feed handles to start drilling. Apply only a slight pressure when the annular cutter touches the metal. Do not push the annular cutter with force into the metal;
9. Apply a regular pressure while drilling. The drilling performance does not improve by putting more pressure on the machine. Too much pressure will overload the motor and your annular cutter will be worn sooner;

A continuous, non-discolored iron swarf is a sign of correct drilling speed and a well-cooled, sharp cutter. Let the cutter do the job and give it time to cut the metal!

10. Stop drilling regularly, refill the holes of the spindle and continue drilling;
11. Apply less pressure when the drill cuts through the material. The slug will be pushed out of the cutter by the pilot pin;
12. Turn the feed handles to put the motor in highest position and switch off the motor unit;
13. Remove the burrs, metal chips and clean the cutter and surface without getting injuries.



WARNING: The slug is sharp and may be hot!

6.2. Twist drills


Weldon shank 19.05 mm (3/4")

Fit the twist drill with 19.05 mm (3/4") Weldon shank (EUROBOOR code SPI or SSPI) with adapter (code IBK.3219) into the provided MT3 to Weldon 31.75 mm (1 1/4") arbor (code 080.2009) and fasten the screws with the provided Allen key. Alternatively use optional MT3 to Weldon 19.05 mm (3/4") arbor (code 100S.2002) without adapter.

Follow the further steps in paragraph Annular cutters.

Standard parallel shank (DIN338)

1. Remove the Morse Taper 3 (MT3) arbor for Weldon shanks (see paragraph 4.2 Morse taper spindle)
2. Fit a MT3 arbor connection
 - a. EUROBOOR code 1/2UNF-MC3 for 1/2" x 20 UNF drill chuck connections
 - b. EUROBOOR code B16-MC3 for B16 drill chuck connections
3. Fit the appropriate twist drill chuck to the arbor
4. Fit the drill with parallel shank and fasten it

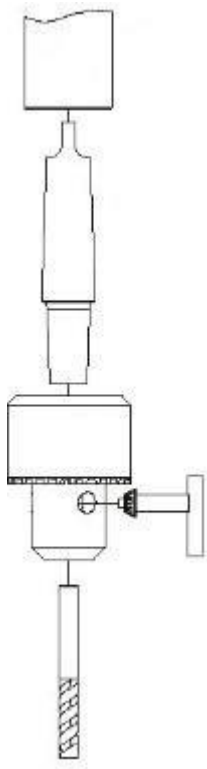


[image 5-2 | Example of fastening a drill with a key]

5. Precisely mark the center of the hole, and use the tip of the twist drill to position the machine.


For further steps see paragraph Annular cutters.

Morse Taper shanks (MT2 or MT3)

1. Remove the Morse Taper 3 (MT3) arbor for Weldon shanks (see paragraph 4.2 Morse taper spindle)
2. Fit a twist drill with a MT3shank
3. For twist drills with a MT2 shank fit an MT3-MT2 adapter (EUROBOOR code IBK.MC3-MC2) before fitting the drill (see below)

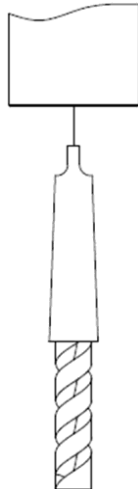

[image 5.3 | Fitting drill with MT3 shank]

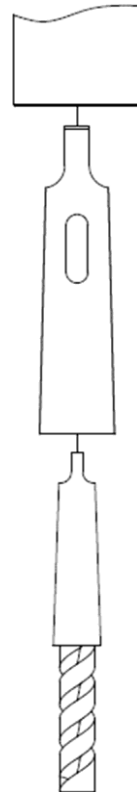

[image 5.4 | Fitting drill with MT3-MT2 adapter]

4. Precisely mark the center of the hole, and use the tip of the twist drill to position the machine.

For further steps see paragraph Annular cutters.

6.3. Machine taps

The machine is equipped with counter clockwise rotation and can therefore also be used for tapping.

Drill tap combination with Weldon 19.05 mm (3/4") shank

6. Fit the drill tap (EUROBOOR code EDT) into a spindle with 19.05 mm (3/4") connection and fasten by tightening the screws with the provided Allen key;
7. Make sure the direction of rotation is set at clockwise (right =R);
8. Drill the required hole and tap simultaneously;
9. Switch off the motor and set the direction of rotation to counter clockwise (left =L);
10. Switch on the motor again, and guide the motor unit upwards with the feed handles to allow the drill tap to come completely out of the workpiece.


Machine taps (DIN 371/376) with Weldon adapter

1. Drill the hole for the tap on the recommended size;
2. Switch off the motor and change the cutter or drill for the tap holder and the machine tap;



WARNING: Do not change the position of the machine!

3. Install the machine tap into the tap holder (EUROBOOR code TCM) and tighten the screws;
4. Fit the tap holder into a spindle with 19.05 mm (3/4") or 31.75 mm (1 1/4") Weldon connection (depending on tap size);

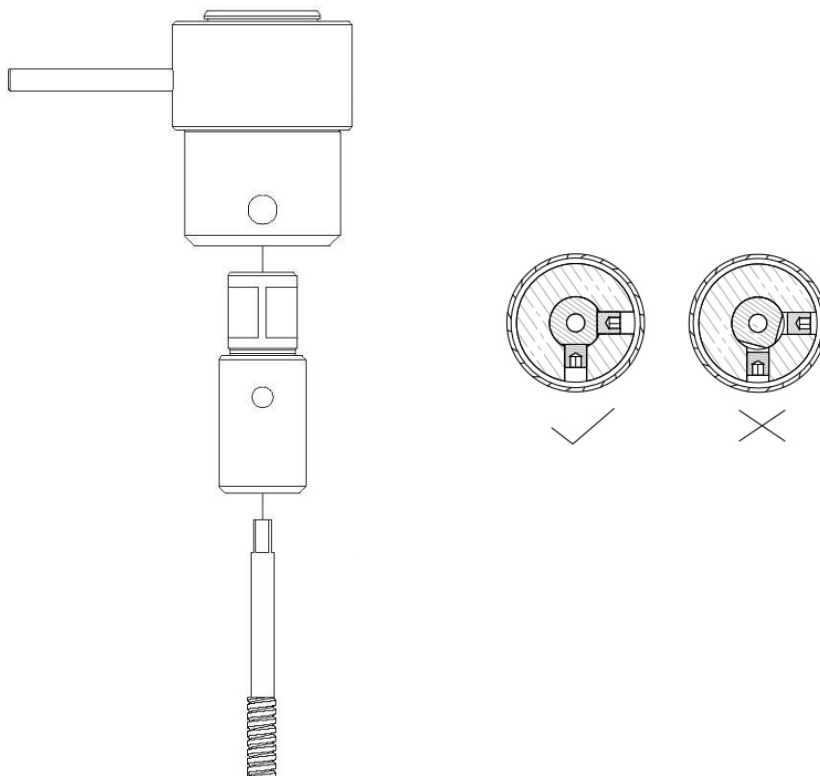

[image5-5]

5. Select the lowest gear and speed and set the direction of rotation to clockwise (right =R);
6. Switch on the motor and set the machine tap onto the drilled hole;
7. Guide the motor unit down with the feed handle without exerting;
8. Switch off the motor and set the direction of rotation to counter clockwise (left =L);
9. Switch on the motor again, and guide the motor unit upwards with the feed handles to allow the drill tap to come completely out of the workpiece.



WARNING: Do not let your tap push up the motor unit by itself!

Make sure to properly lubricate while performing tapping work, see paragraph 5.1 Annular cutters.

6.4. Countersinks

 
Thanks to its wide range of operating speeds, the machine can also be used for reaming or counter-sinking. Follow the steps mention in paragraph 5.2 Twist drills.

6.5. Milling

The machine is equipped with a cross slide table that allows the movement at two directions, and can therefore also be used for light milling.

1. fit the milling cutter into the corresponding ER32 collet and secure it by tightening the union nut of MT3 milling chuck (optional Euro code MC3.ER32).
2. Switch on the magnet and verify that the drill is in the right position and that the machine is pushed tight against the workpiece;
3. Using the feed handle to make the cutter at the correct height, then lock the sliding rail with the stop screws.

4. Switch the motor on and allow it to run at the required speed.
5. Guide the cutter by rotating the X- or Y-axis hand wheel, to perform milling operation on the workpiece.



[image5-6]



WARNING: Do not switch off magnet when cross slide table is stretched out to the front.

7. Maintenance

Your EUROBOOR magnetic drilling machine has been designed to operate over a long period of time. Continuous satisfactory operation depends upon proper tool care and regular cleaning.



CAUTION: *To reduce the risk of injury, turn the machine off and disconnect machine from power source before installing and removing accessories, before adjusting or changing set- ups or when making repairs. Be sure the switch is in the OFF position. An accidental start- up can cause injury.*

Just as every magnetic drilling machine with moving parts, your EUROBOOR magnetic drilling machine also needs regular maintenance service. A few recommendations follow :

Visually check the machine for damage

The machine must be checked before operating for any signs of damage that will affect the operation of the machine. Particular notice must be taken of the main cable, if the machine appears to be damaged it should not be used. Failure to do so may cause injury or death.

Cleaning

Clean all dirt, dust, metal chips and burrs of your magnetic drilling machine;
Blow dirt and dust out of the main housing with dry air as often as dirt is seen collecting in and around the air vents. Wear approved eye protection and an approved dust mask;
Never use solvents or other harsh chemicals for cleaning the non-metallic parts of the tool.
These chemicals may weaken the materials used in these parts. Use a cloth dampened only with water and mild soap. Never let any liquid get inside the tool; never immerse any part of the tool into a liquid.

Operation of the machine

The machines operation must be checked to ensure that all components are working correctly. Replace any defective parts immediately. This prevents properly functioning parts from being damaged.

Check magnetic base

Before every operation the magnetic base should be checked to make sure that the base is flat and there is no damage present. An uneven magnet base will cause the magnet to hold not as efficiently and may cause injury to the operator. When the machine is put out of use for a longer period, apply a small amount of machine oil to the underside of the magnetic base for rust protection. Clean the magnetic base again with next use.

Check gearbox oil (IBO.G101)

The oil should be checked once a month to ensure all moving components are covered to prevent wear. The oil should be changed at least once a year to ensure you gain the best from the machine.

Carbon brush replacement

Schedule to replace the carbon brushes when the carbon brush LED indicator lights up. The remaining operating time depends on the use of the machine. When the carbon brushes are fully worn, the machine will shut-off automatically. Replace both carbon brushes at the same time.



WARNING: *Replace both carbon brushes in the motor unit always simultaneously. Failing to do so may affect the LED warning function and lead to motor damage.*

Check armature

This should be checked at least once a month to check if there are visual signs of damage to the body or to the commutator. Some signs of wear will be seen on the commutator over a period of time this is normal as this is the part that comes in contact with the brushes but any signs of abnormal damage means the part should be replaced.

Adjustment of slide

An essential requirement of the machine is that the slide can move in a smooth and controlled manner, free of lateral movement and vibration.

This situation can be maintained by periodic adjustment of the slide and can be accomplished in the following manner:

Place the machine in an upright position and, by means of the capstan, raise the slide to its highest position. Clean the aluminum rails and apply a small amount of light machine oil to the wear surfaces; Gently feed in setting screw with supplied Allen key 2.5 until slight resistance is encountered. Follow your way down adjusting all setting nuts and screws;

Operate the slide up and down a few times to test the movement and make any further necessary adjustments. Try to ensure that all the screws are exerting a uniform pressure on the slide from top to bottom. A perfectly adjusted slide will operate freely up and down without any side ways movement.

Lubricating the feed travel

The feed travel should be lubricated periodically with grease to ensure smooth operation.

Raise the motor unit to the highest position possible;

Lubricate the dove-tail guideway at both sides;

Lubricate the gear rack.

After repeated use, the gear rack may become loose. If necessary, adjust the five self-locking set screws at the left side. Tighten screws in series until the gear rack moves freely in the dove-tail guideway but does not allow the motor to wobble.

Repair, modification and inspection

Repair, modification and inspection of EUROBOOR Magnetic drilling machines must be done by EUROBOOR or an EUROBOOR authorized dealer. The spare parts list will be helpful if presented with the machine to the EUROBOOR dealer for service when requesting repair or other maintenance.

EUROBOOR machines are constantly being improved and modified to incorporate the latest technological advancements. Accordingly, some parts (i.e. part numbers and/or design) may be changed without prior notice. Also, due to EUROBOOR's continuing program of research and development, the specifications of machines are subject to change without prior notice.



WARNING: *Since accessories, other than those offered by EUROBOOR, have not been tested with this machine, use of such accessories with this tool could be hazardous. To reduce the risk of injury, only EUROBOOR recommended accessories should be used with this machine.*

Consult your dealer for further information on the appropriate accessories.


8. Troubleshooting


Magnet and motor do not function	<ul style="list-style-type: none"> - The magnet switch is not connected to the power supply - Damaged or defective wiring - Defective fuse - Defective magnet switch - Defective control unit - Defective power supply
Magnet does function, the motor does not work	<ul style="list-style-type: none"> - Damaged or defective wiring - Carbon brushes are stuck or worn out - Defective magnet switch - Defective On / Off switch - Defective control unit - Defective armature and/or field
Magnet does not function, the motor does	<ul style="list-style-type: none"> - Defective magnet - Defective wiring of magnet - Defective control unit
Annular cutters break quickly, holes are bigger than the annular cutter	<ul style="list-style-type: none"> - Clearance in the guide - Bent spindle - Shaft extending from the motor is bent - Bent pilot pin
Motor running roughly and/or seizing up	<ul style="list-style-type: none"> - Bent spindle - Shaft extending from the motor is bent - Triangular guide not mounted straight - Dirt between spindle and triangular guide
Motor starts running when magnet switch is turned on	<ul style="list-style-type: none"> - Damage or defective relay in control unit
Motor making a rattling sound	<ul style="list-style-type: none"> - Gear ring (bottom of the armature) worn out - Gear(s) worn out - No oil in gearbox
Motor humming, big sparks and motor has no force	<ul style="list-style-type: none"> - Armature damaged (burned) - Field burned - Carbon brushes worn out
Motor does not start or fails	<ul style="list-style-type: none"> - Damaged or defective wiring - Dirt in sensor control unit - Defective or loose magnet on top of armature - Damaged or defective (sensor) control unit - Damage to armature or field coil - Damaged or defective carbon brushes
Guiding takes a great deal of effort	<ul style="list-style-type: none"> - Guide is set too tight - Guide is dry, needs to be greased - Guide/gear- rack/rotation system dirty or damaged
Insufficient magnetic force	<ul style="list-style-type: none"> - Damaged or defective wiring - Bottom of magnet not clean and dry - Bottom of magnet not flat - Workpiece is not bare metal - Workpiece is not clean or flat - Workpiece is less than 6 mm (too thin) - Defective control unit - Defective magnet


Frame under voltage	<ul style="list-style-type: none"> - Damaged / defective wiring - Defective magnet - Motor seriously dirty
Fuse blows when magnet switch is turned on	<ul style="list-style-type: none"> - Damaged or defective wiring - Wrong value fuse - Defective magnet switch - Defective control unit - Defective magnet
Fuse blows when motor is started	<ul style="list-style-type: none"> - Damaged or defective wiring - Wrong value fuse - Motor running roughly - Defective armature and / or field - Carbon brushes worn out - Defective control unit
Rotation system free stroke too long	<ul style="list-style-type: none"> - Loose or defective gear rack - Defective rotation system
Red blinking light in top display with beeping sound	- Machine is in overload protection
Red burning light in top display with beeping sound	- Machine is in overheat protection

9. Exploded views & spare parts list

9.1. Exploded views

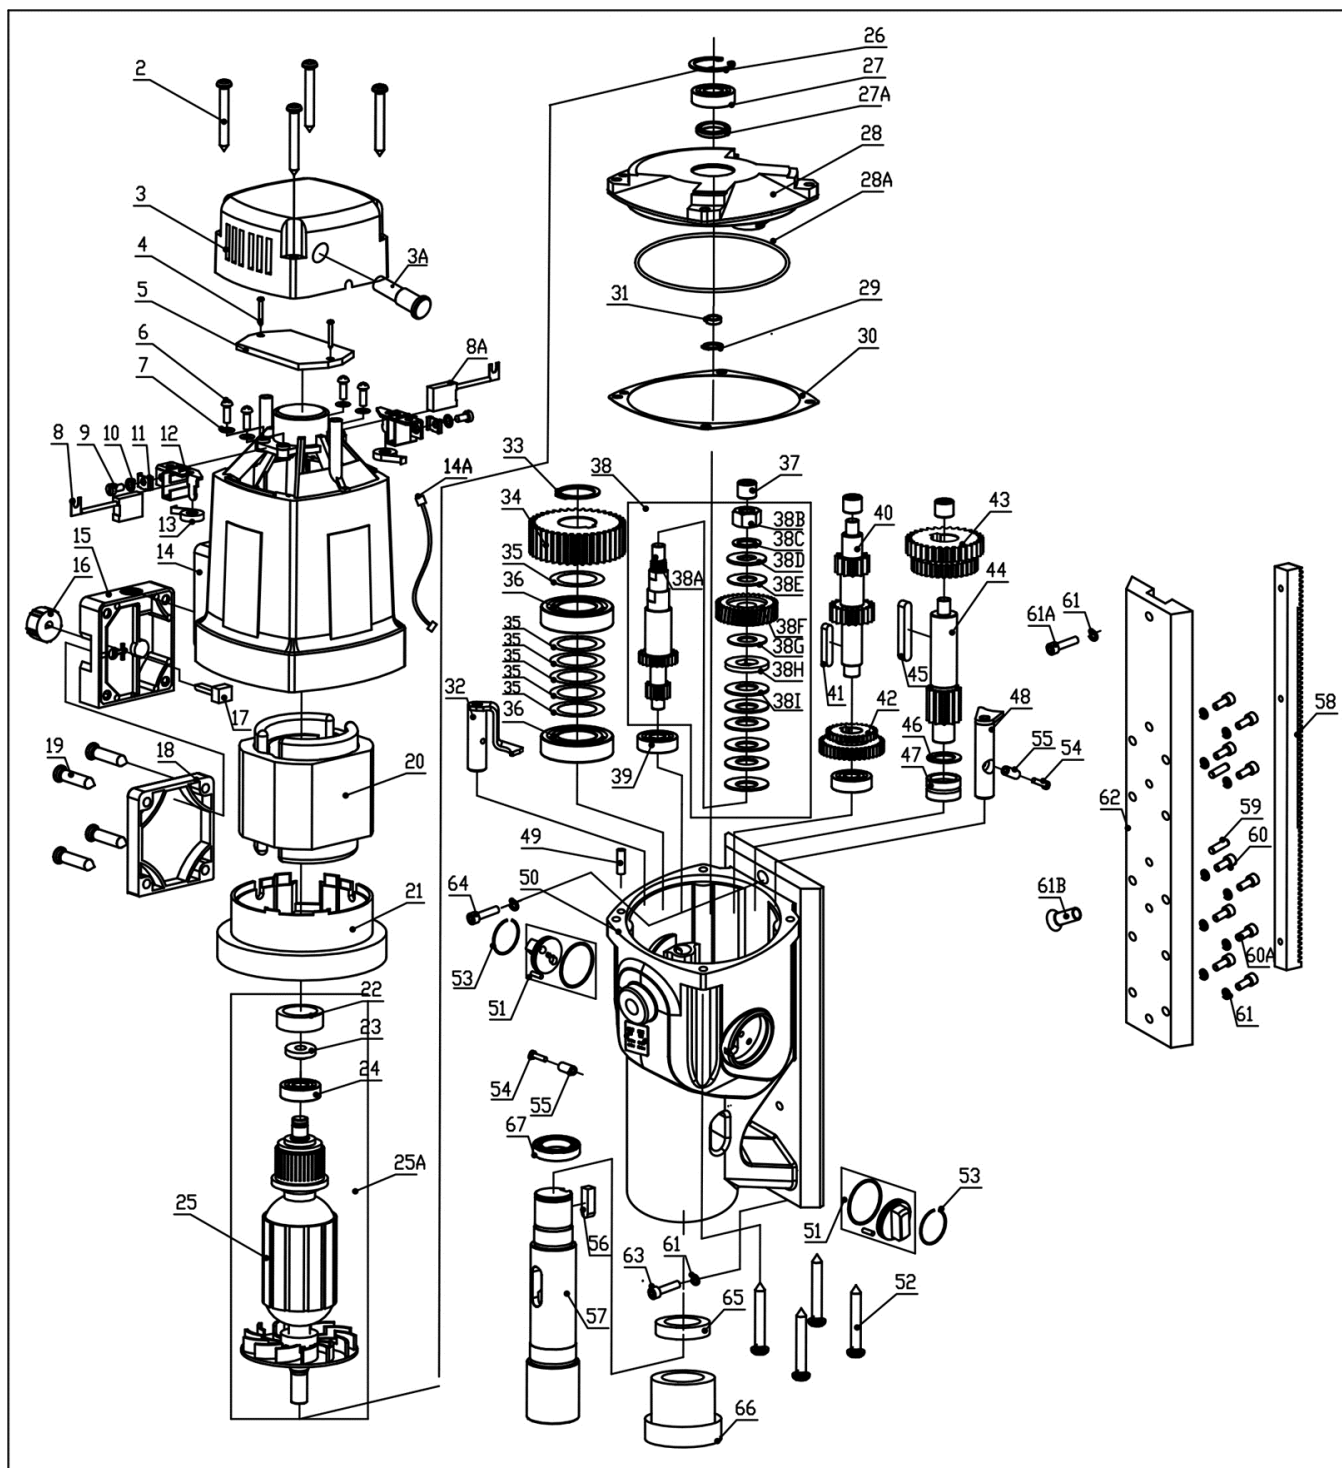

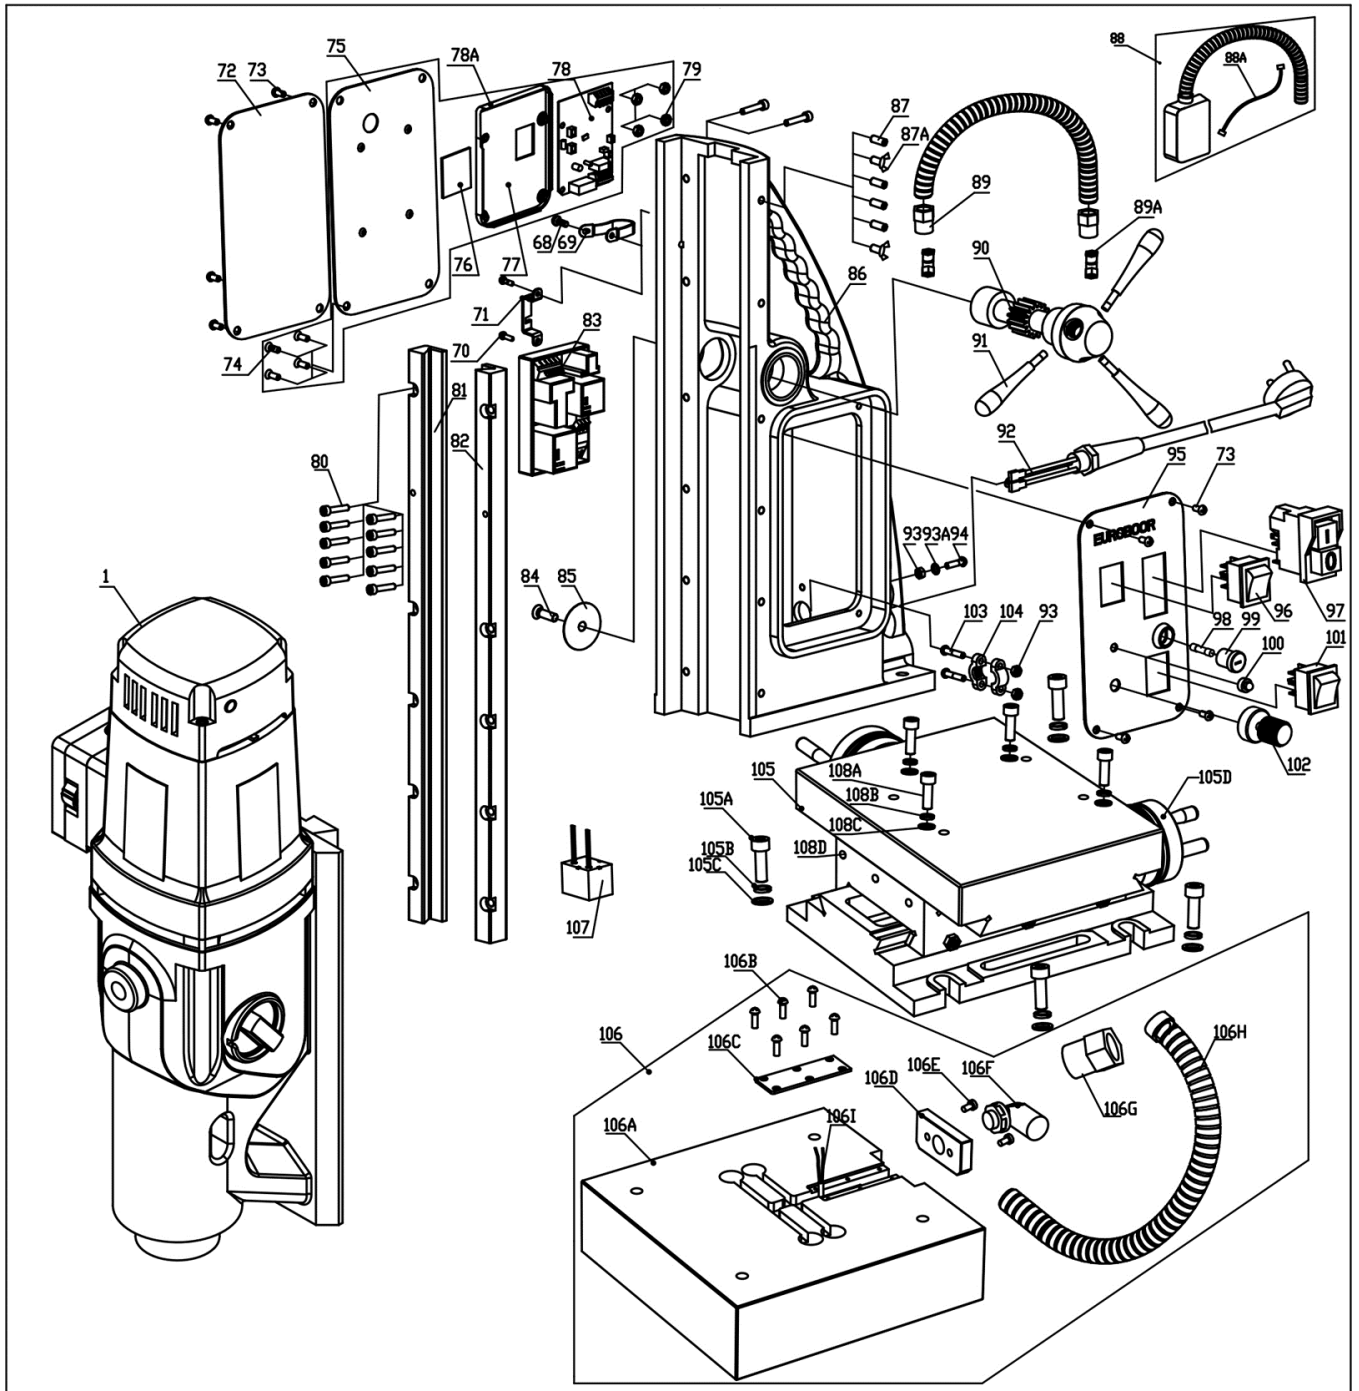

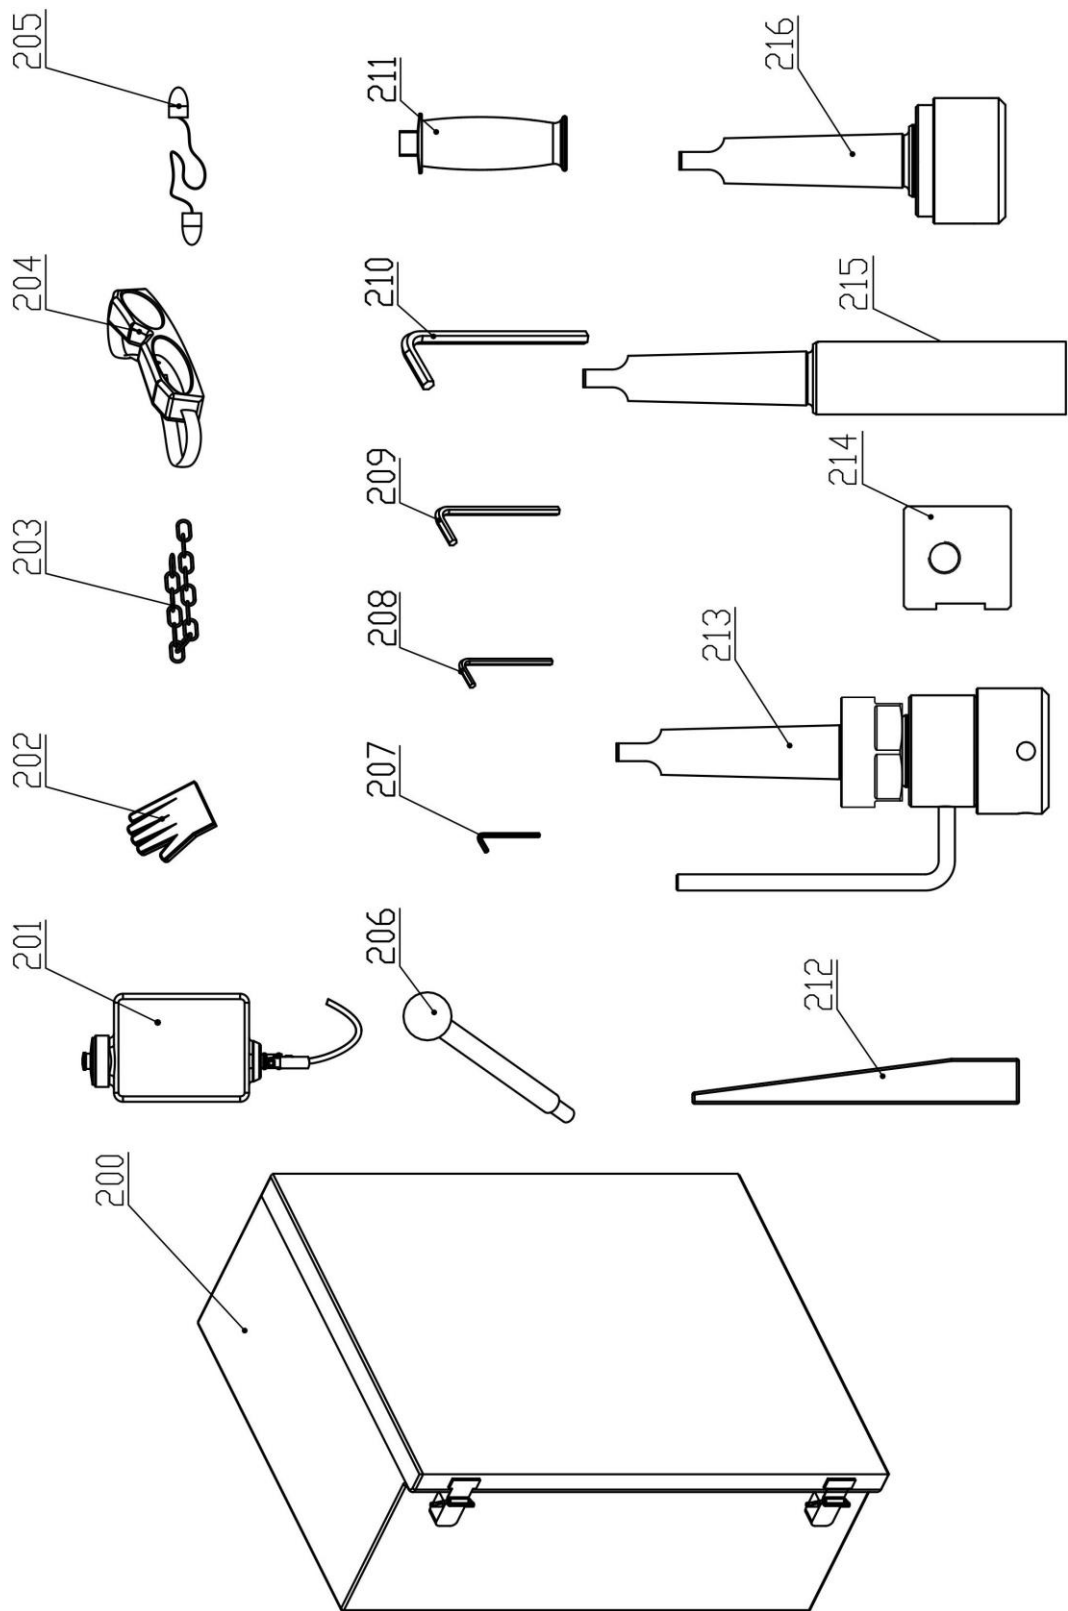


9.2. Spare part lists

No.	Part no.	Description	Qty
1	100SCT.2001	Motor 220V (Assembly)	1
	100SCT.2001A	Motor 110V (Assembly)	
2	050.0106	Screw 4.8 x 45	4
3	100.0322Z	End cover	1
3A	P020.0278	LED red alarm 220V	1
	P020.0278A	LED red alarm 110V	
4	032.0116	Screw M4 x 16	2
5	100S.0340	Control unit B 110V/220V	1
6	100.1002	Carbon brush holder set	1
7			
9			
10			
11			
12			
13			
8	Carbon.100+	Carbon bursh set 220V	1
8A	Carbon.100A+	Carbon brush set 110V	
14	100.0388100S+/CT	Housing	1
14A	100.0342-02	Cable set 1608	1
15	130.0023	switch housing	1
16	130.0027	Red wheel	1
17	130.0026	Torque potentiometer 1 K	1
18	130.0024	T/S switch cap	1
19	100.0616	Screw	4
20	100.1004A-CK-1	Field 110V	1
	100.1004-CK-1	Field 220V	
21	100.0391	Baffle	1
25A	100S.1011	Armature set 220V	1
	100S.1012	Armature set 110V	
26	032.0166	Circlip 472/28/1.2	1
27	050.0070	Bearing	1
27A	100S.0064	Oil Bearing 15 x 23 x 3	1
28	100S.0401X	Inner gear plate	1
28A	100S.0071	O-ring 106 x 1.8	1
29	0020	Circlip 471 11 x 1	1
30	100.0458	Gasket	1
32	100S.1006	Clutch shaft	1
33	100.0426	Circlip 471 24 x 1.2	1
34	130.0018	Spindle gear 38T	1
35	100.0441	Adapter ring	6
36	100.0446	Bearing 6005	2
37	040.0161	Needle bearing HK0810	3
38	100.1007	Gear shaft complete	1
39	080.0506	Bearing	2
40	130.0020	Gear axle	1
41	040.0301	Key	1
42	130.0019	Double gear 1 25T+39T	1
43	130.0016	Double gear 2 36T+41T	1
44	130.0021	Axle 3 (13T)	1
45	080.0526	Key 3	1
46	080.0486	Washer 14 x 22 x 1	1
47	080.0481	Needle bearing	1
48	100S.1007	Clutch shaft	1
49	100.0549	Casing pin	1
50	100S.1017	Gear box	1
51	100S.1014	Gear switch	2
52	100.0459	Screw BK 5.5 x 45	4
53	050.0078	Ring 41.5 x 36.5 x 1.5	2

No.	Part no.	Description	Qty
54	020.0329	Screw M4 x 16	2
55	050.0082	Screw holder	2
56	080.0431	Key spindle 6 x 6 x 20	1
57	100SCT.0901	Spindle drive shaft	1
58	100SCT.0076	Rack 1.5 x 58T	1
59	020.0003S	Pin	2
60	020.0106	Bolt M6 x 16	8
60A	020.0106E	Bolt M6 x 14	2
61	020.0106C	Washer M6	13
61A	020.0146S	Bolt M6 x 22	1
61B	020.0106D	Screw M6 x 20	1
62	100S.0462X	Slide	1
63	020.0146S	Screw M6 x 22	1
64	020.0012	Screw M6 x 12	1
65	100S.0067	Wool felt ring	1
66	100S.0066	Bearing NKX-45	1
67	100S.0065	Bearing 35 x 42 x 8	1
68	020.0063	Screw M5 x 10	1
69	020.0298	Motor cable clamp	1
70	020.0063	Screw M5 x 10	2
71	020.0289	Tank holder	1
72	080.0016BX.5A	Rear panel 220V	1
	080.0016AX.2A	Rear panel 110V	
73	020.0101	Panel screw BKVZ M4 x 8	8
78A	100.1028	Speed control unit 220V	1
	100.1028A	Speed control unit 110V	
80	100.0022	Bolt M5 x 20	12
81	100.0193A	Aluminum Rail(L)	1
82	100SCT.0193B	Aluminum Rail(R)	1
83	100.1014	Control unit (220v)	1
	100.1014A	Control unit (110v)	
84	020.0081	Screw M6 x 16	1
85	020.0077H	End plate black	1
86	100SCT.1002	Frame complete	1
87	020.0301	Screw M5 x 10	4
87A	020.0386	Stop screw	2
88	100.1010A	Motor cable complete	1
90	100.0101H	Capstan hub black	1
91	020.0314X	Arm for capstan	3
92	100.1016	Main cable (220v)	1
	100.1016A	Main cable (110v)	
93	020.0182C	Nut M4	3
93A	040.0286F	Washer M4	1
94	020.0182A	Screw M4 x 15	1
95	100SCT.0008X	Front panel	1
96	100.0152	R/L switch(push)	1
97	BY.0006A	Motor switch 220V	1
	020.0014	Motor switch 110V	
98	020.0016B	Fuse 5 x 20 F2A	1
99	020.0016A	Fuse holder	1
100	032.1006	LED indicator set	1
101	020.0011-1	Magnet switch	1
102	100.1009	Potentiometer	1
103	020.0182D	Screw M4 x 20	2
104	020.0115	Cable clamp	2
105	100SCT.0001	Cross slide table	1
105A	020.0139	Screw	4
105B	B60.0030	Washer M10	4
105C	020.0821	Washer	4

No.	Part no.	Description	Qty
106	100SCT.1004	Magnet complete 220v	1
	100SCT.1004A	Magnet complete 110v	
106A	020.0123	Magnet	1
106B	020.0122	Screw	6
106C	020.0129	Fixed plate	1
106D	020.0124	Adapter	1
106E	020.0074	Screw M5 x 12	2
106F	030.0021	Coupling nut PG9(elbow)	1
106G	020.0041	Coupling nut PG9	1
106H	020.0046	Bellows AD13	1
106I	020.0261	Reed switch	1
107	100.0018	Filter	1
108A	100A.0014	Screw M8x25	4
108B	020.0305	Washer M8	4
108C	100A.0015	Spring washer M8	4
108D	020.0136S	Set screw M6 x 16	3
200	100SCT.1005	Case	1
201	100S.2019	Coolant tank	1
202	PRM.61	EUROBOOR gloves M	1
	PRM.62	EUROBOOR gloves L	
	PRM.63	EUROBOOR gloves XL	
203	032.2013	Safety chain	1
204	SAF.100	Safety goggles	1
205	SAF.200	Ear plugs	1
206	032.2018	Handle for tank(Assembly)	1
207	IMB.US2.5	Allen key 2.5 mm	1
208	IMB.US4	Allen key 4.0 mm	1
209	IMB.US5	Allen key 5.0 mm	1
210	IMB.US6	Allen key 6.0 mm	1
211	100S.0002	Side handle M12	1
212	DRIFT3	Drift MT3	1
213	100SCT.2009	Spindle MT3 31.75 mm Weldon (1 1/4")	1
214	IBK.3219	Reducing ring Weldon 31.75mm – 19.05mm	1
215	IBK.MC3-L121	Extension MT3	1
216	MC3-ER32	MT3 Milling chuck(optional)	1

9.3. Wiring diagram

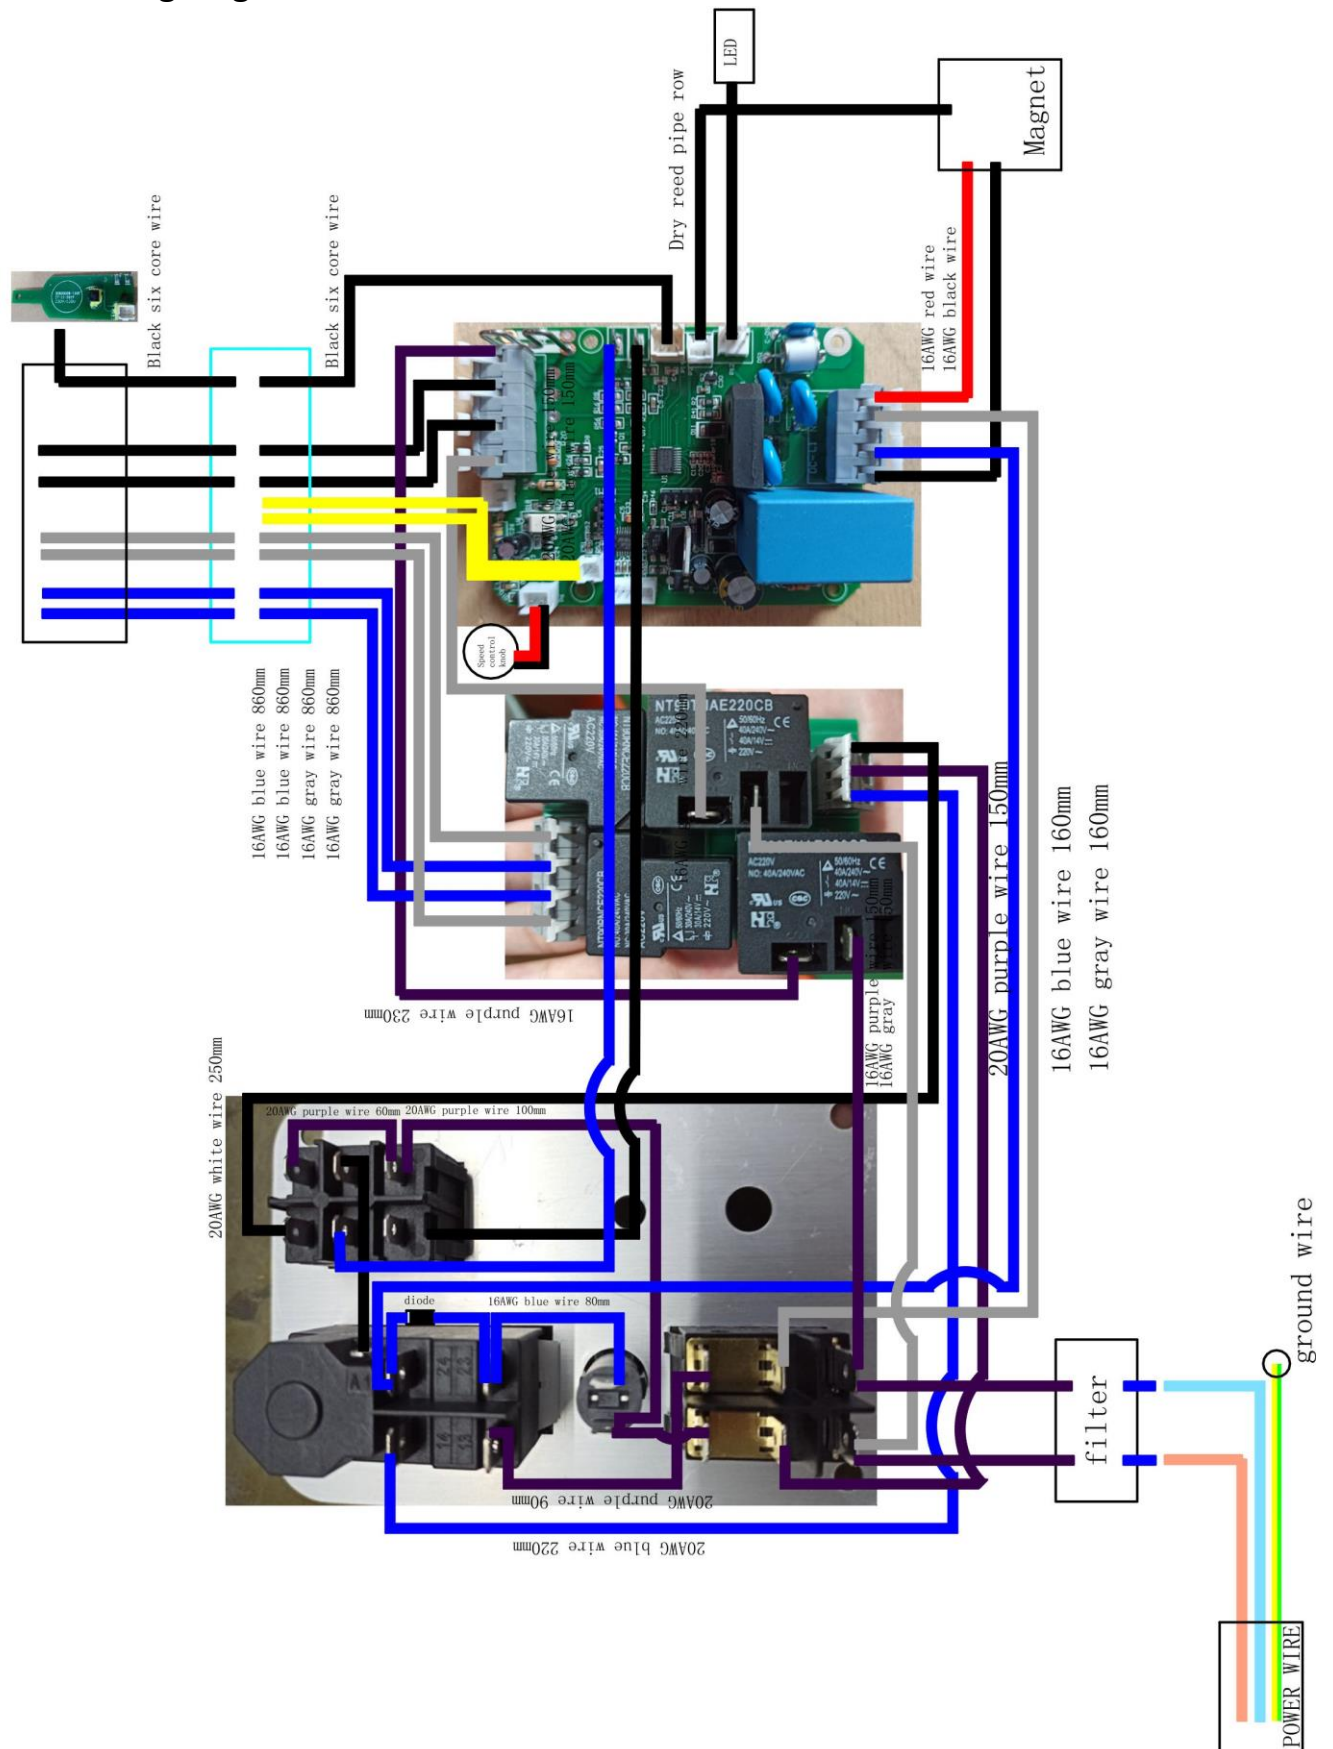

9.4. Warranty and service

Warranty

Euroboor B.V. warrants this magnetic drilling machine to be free of material defects and workmanship errors under normal use for a period of 12 months after date of purchase.

This 12 month period can be extended to 24 months in total by registering the product on our website: <https://euroboor.com/support/register/>.

Serial number:

Date of purchase:

Don't forget to register your machine at:

<https://euroboor.com/support/register/>

[only when registered you benefit from extended warranty]

Service

To maximize the lifetime of your EUROBOOR machine always use service and parts from an official EUROBOOR distribution channel. Whenever in need of such, always contact original point of sales or, if no longer existent, the distributor of EUROBOOR products in your count